

1. DN456- Since the lifting hook was moved to the outside of the box, the motor and arm can't clear. Pictures attached
 - Solution- Recommend replacing rail with AKK31134, or sliding the rail forward

2. DN485- front and rear ratchet hole placement incorrect.
 - Solution- Order Agri-Cover PN 4003907 (instructions attached PN 2000267)
 - All the new kits include the brackets

3. R series 4030, 4038, 4044, 4045, 4060- The wiring plug is outside the battery box on models that will have the dry box switched out for a sprayer tank. It is located on frame about halfway back on the drive side of the chassis
 - Solution- A 20' jumper wire to hook to the Command Center is needed. Order Agri-Cover PN 4003767. (instructions attached PN 2000177)
 - If a new tarp kit is ordered request a tarp kit with the rocker switch and dis-guard the rock switch

4. AB485 -Ladder platform in the way of the tarp motor
 - Solution- Order Agri-Cover PN 4002792 (instructions attached PN 2000187)
 - All new kits have the Limit Switch included in the kit

5. <https://www.agricover.com/rolltarps/john-deere/> this will always be up to date